

Vehicle Description

Mercedes-Benz CLA 45 AMG


DATE INSPECTED: 01/03/2016 INSPECTION POINTS CHECKED: 150+

VIN JN1TANT31A0003024 **Engine Number** 2XA76364 **Compliance Date** 10/2014 **Build Date** 08/2015

Odometer Reading 12633 Registration Number MBCLA45 11/06/2017 **Registration Expiry** Pre-purchase Reason for inspection





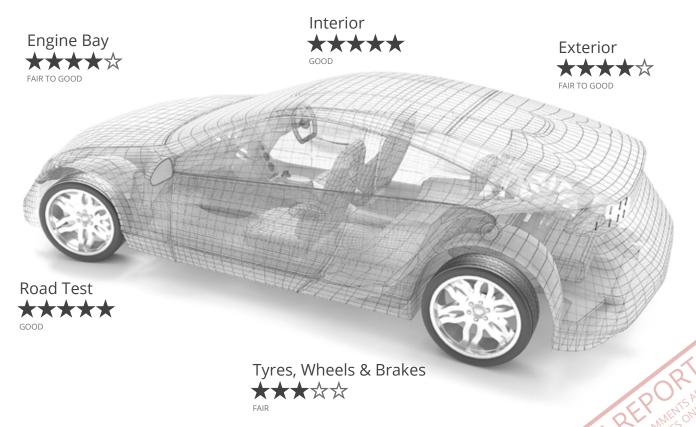

The inspection is visual and non-mechanical only. Refer to terms and conditions on last page for further details and explanation of ratings.

Graphic is not actual vehicle







Interior **	*
****	Seats Very good condition
****	Seat Belts All working and in good order
****	Other Trims All in good condition , slight scuff marks in lower section of all door trims , respectable condition for age and wear
****	Radio
****	Rear Window Demister Operational, no scratches in demister lines
****	Air Conditioning Working and cold
****	Heater Demister All working , all levels checked
****	Washers & Wipers All working
****	Horn Working order
****	Doors, Locks & Hinges General wear and tear marks
****	Window Operation Working from all window switches , window tinting has been installed to all windows , no scratches detected
****	Dash Warning Lights & Gauges No warning lights on , all systems are serviceable
****	All Lights All lights are operational and lenses are complete
****	Other Overall very good condition for the age and kms

★★★★ GOOD

★☆☆☆☆ POOR

★★★☆☆ FAIR

NA NOT APPLICABLE

NC NOT CHECKED



Interior Visual Details







Exterior **	$\stackrel{\wedge}{\sim}$
****	Rust No rust detected , vehicle has not seen a lot of unsealed roads by the look of the underbody
***	Body Repairs Rear tailgate has been re-painted
****	Glass & Mirrors All glass is tinted and in good condition
****	Sunroof, Aerial & Convertible Aerial & Sunroof fitted. All in working order.
****	Frames & Members No structural damage detected at the time of inspection
****	Under Body Parts Some inner guard linings have been replaced possibly on the drivers side
****	Front Suspension Good condition consistent with the age and kms
****	Rear Suspension Good condition consistent with the age and kms
****	Steering Components Good condition consistent with the age and kms
****	Transmission Housing Manual transmission , slight leakage detected
****	Exhaust Original condition
****	Differential Original condition , no noises detected
****	Drive Shafts Slight leakage from outer c.v. boot. Front tail shaft bracket and rear shaft has been replaced
***	Other Overall good condition consistent with the age and kms, some paintwork in o/s of the vehicle needs attention also rear tailgate needs to be repainted
**** GOOD	★★★☆☆ FAIR ★☆☆☆☆ POOR NA NOT APPLICABLE NC NOT CHECKED



Exterior Visual Details







Engine Bay	$\stackrel{\wedge}{\sim}$
***	N

Noise

No noises detected when hot , injectors are slightly noisy when cold

★☆☆☆ Fluid Level

All fluid levels are at correct level , wrong coolant has been installed , vehicle should have red coolant fitted not green

★★★★ Fluid Leaks

No fluid leaks detected

★★★★ Mountings

Consistent with age and kms

Hoses & Pipes
Consistent with age and kms

consistent with age and kins

★★★★ Water Pump & Fan

Original pump , no leaks detected

★★★★ Ignition System

Good condition, operational

Fuel System

Good condition consistent with the age and kms

**** Battery

Super charge heavy duty battery installed

★★☆☆ Radiator & Cap

Evidence of previous coolant leak in top of radiator tank, top use area.

★★★★ Drive Belt & Pulleys

New drive belt has been installed

**** Brake Booster

Working condition

★★★★★ Master Cylinder Pressure & A.B.S. Function

Working condition

Other

Engine repairs have just been performed to the front of the motor in the timing case area, extent of repairs

unknown. Current coolant needs to be flushed and replaced with correct coolant.

★★★★ GOOD ★★★☆☆ FAIR ★☆☆☆☆ POOR NA NOT APPLICABLE NC NOT CHECKED



Engine Bay Visual Details







Tyres, Wheels & Brakes



Excellent condition, as new

**** Wheel Rims

Alloy wheels all round, unmarked

**** Spare Tyre & Rim

Good condition and good tread, steel rim

**** Brake Hose Callipers & Pipes

Original condition

**** **Brake Pads**

Front brake pads need replacement before next service approx 70% worns

**** **Brake Discs**

Discs will require machining

NC **Brake Linings**

Wheels on rear not removed, no leaks detected

NC Wheel Cylinders

Unseen , no leaks detected

Brakes and Drums NC

**** Park Brake

Adjustment needed

**** Wheel Bearings

Front wheel bearings are noisy

*** Other

Brakes require service soon

★★★★★ GOOD

★★★☆☆ FAIR

★☆☆☆☆ POOR

NA NOT APPLICABLE

NC NOT CHECKED









Tyres, Wheels & Brakes Visual Details







Road Test	*
****	Ease of Starting & Idle Runs well for kms and age
****	Engine Noise No noises detected
****	Engine Performance Runs well, good performance
****	Exhaust Smoke & Emissions No smoke detected at time of inspection
****	Gearbox Drive Operation Top bush in gearstick needs replacement , possibly the whole gearstick , further diagnosis needed. Bearing noises detected in 3rd/4th gears needs further diagnosis.
****	Differential No noises detected
****	Steering & Suspension Good consistent with the age
***	Brake Operation Brake well , requires adjustment in the rear brake shoes
****	Speedo Working condition
****	Cruise Control Working condition
NA	4 Wheel Drive Front wheel bearings are noisy
****	Camshaft & Drive Belt Has just been replaced
****	Owner's Manual & Service Intervals With the vehicle and up to date, due for service now not stamped
NA	Other REPORT

★★★★ GOOD ★★★☆☆ FAIR

★☆☆☆☆ POOR

NA NOT APPLICABLE

NC NOT CHECKED



Overall











General Comments

Bodywork on drivers side fair , service items require attention , see notes , clutch will need repairs soon and further diagnosis, driveline noise detected also from wheel bearings are noisy

Possible internal gearbox problems in 3rd / 4th gears



Ratings

GOOD Item found to be in working order and/or no obvious signs of damage/degradation, consistent with age & kms of vehicle.

FAIR Item found to be in working order with some signs of damage and/or wear & tear, consistent with age & kms of vehicle. ***

Item found not to be in working order and/or major signs of damage and/or wear & tear. **** POOR

NOT APPLICABLE Vehicle does not have this item fitted/installed. NA

NOT CHECKED Potential defect observed but item not further investigated/dismantled. NC

Disclaimer

- (a) The inspection is VISUAL and non-mechanical only and RedBook Inspect will not be responsible for any defects that are latent discovered which were not visually apparent during the inspection. The inspection will cover the vehicle's exterior, interior, engine compartment, tyres and wheels, brakes, under body and a road test where possible. The inspection will specifically not cover the items set out below. No removal of parts or components is undertaken during the inspection process. You acknowledge that while RedBook Inspect's inspectors use accepted methods for fault detection, these methods will not necessarily identify all faults with a vehicle. You should consider the age and condition of the vehicle at the time of inspection and any Report should be reviewed in this context. Vehicles are only road tested to speed limit of local area.
- (b) The Report provided by RedBook Inspect to you is only current as at the time it is issued. It is a buyer's responsibility to conduct a visual inspection of the vehicle at the point of sale as RedBook Inspect can only advise on the condition of the vehicle at the time of inspection. The Report is not a roadworthy certificate and cannot be used as a roadworthy. You acknowledge that RedBook Inspect does not check for any manufacturer recall notices and you should check that the vehicle is not subject to a recall notice.
- (C) RedBook Inspect will not be responsible for the terms of any transaction between any persons in relation to any vehicle inspected by RedBook Inspect or for resolving any dispute between any persons regarding any transaction.
- (d) Subject to all applicable laws, RedBook Inspect does not provide any guarantee, warranty or representation regarding the nature, reliability, accuracy or completeness of any information contained in the Report or the fitness of the information contained in the Report for any purpose intended by you. To the full extent permitted by the law, RedBook Inspect will only be liable to you: (i) pursuant to any guarantee, right or contractual term that arises, is created or is implied by operation of law and that cannot be excluded PROVIDED THAT to the full extent permitted by law, any such liability of RedBook Inspect is limited, at RedBook Inspect's option, to (A) replacing or repairing the relevant goods (B) supplying goods equivalent to the relevant goods (C) supplying the relevant services again; or (D) paying the cost of such replacement, repairs or supply, subject always to subclause (g) below; or (ii) if Your claim arises from or in connection with any deliberate breach of these terms and conditions or fraud by RedBook Inspect.
- (e) Except to the extent that liability cannot be excluded, RedBook Inspect, will not be liable to you for claims arising out of or in connection with your access and use of the this Report whether arising in contract, tort (including negligence), indemnity, strict liability, breach of warranty or statute.
- (f) To the full extent permitted by law, RedBook Inspect will not be liable to you for loss of use, production, profit, revenue, business, data, contractor anticipated savings or for delay or for any financing costs or increase in operating costs or any economic loss for any indirect or consequential loss or damage.
- (g) Your use of this Inspection Report is subject to the RedBook Inspect Service Terms available at http://www.redbookinspect.com.au/terms-of-service

RedBook Inspect does not check the following items

- Brake function and lining material, brake drums, limited to what is immediately visible
- Evidence of brake fluid contamination
- Anti-lock braking system (ABS) mechanics
- Meters indicating oil and fuel consumption or the degree of oil and fuel consumption
- Reason for oil leaks
- Oil pump strainer to assess sludge build up
- Wheel cylinders
- Vehicle electrics and electronics
- Transmission mechanics
- Engine cylinder compression
- Engine mountings
- Water pump/fan
- Body water leaks or reason for leaks

- Odometer and camshaft belt, drive belt and timing belt
- Estimated expiry of exhaust system, clutch, dual mass flywheels
- Standard to which repairs or service history have been completed
- Functionality of audio-visual or entertainment system including CD, Cassette, TV, DVD, iPod connectivity, sensors, alarm/security devices, satellite navigation systems/GPS
- Degree of gas emissions
- Catalytic converters
- Additional accessories included as a result of owner's modifications
- Mechanical switching of wipers and lights
- LPG systems
- Air conditioning efficiency
- Status of habitation areas of motorhomes or caravans
- Vehicle's computer systems, such as trip meter computers, cruise control and any other computer systems
- Technical systems





